



Service Bulletin

Date:

7/9/2025

Affected Models:

All vehicles

Internal or External Use:

Both

Bulletin Title

Upgraded Outer CV Hardware

Reason

To achieve a higher preload on the outboard cv joints and increase the clearance between the cv joint bolts and the lower shock connection nut.

Action

The outboard cv joint bolts will be replaced with 12-point M8x1.25x45mm bolts and torqued to 35 ft-lbf.

The lower shock connection nut will be replaced with an M10x1.5 jet nut and torqued to 20ft-lbf.

The same bevel washer will be used but should be replaced as a consumable. Refer to the chart below for the replacement part number.

Older Part Number	New Part Number
RAWPP-396	RAWPP-1470
RAWPP-257	RAWPP-1472

Part Replacement

Contact Rush Auto Works where an update kit can be purchased. This will include 24pcs of RAWPP-1470, 4pcs of RAWPP-1472, 24 pcs of RAWPP-606