



Service Bulletin

Date:

6/26/2025

Affected Models:

All Models

Internal or External Use:

Both

Bulletin Title

Fire Suppression Cable Check

Reason

The fire suppression handle was unable to be pulled by hand and could prevent the suppression system from activating. The set screw that retains the cable housing inside the cap of the fire extinguisher could be installed improperly, clamping the pull cable instead of the cable housing.

Action

The fire suppression pull cable will be evaluated for proper function. If it cannot be operated, the fire suppression cable will be removed and inspected for damage from the set screw. If none is found, the cable and housing will be reinstalled and checked to confirm the cable can be moved with minimal force. If damage is found, a replacement cable and housing assembly will be installed.

Part Replacement

If the cable is found damaged, a new cable assembly will be needed.

Instructions

Follow supporting documentation for Fire Suppression Cable Check